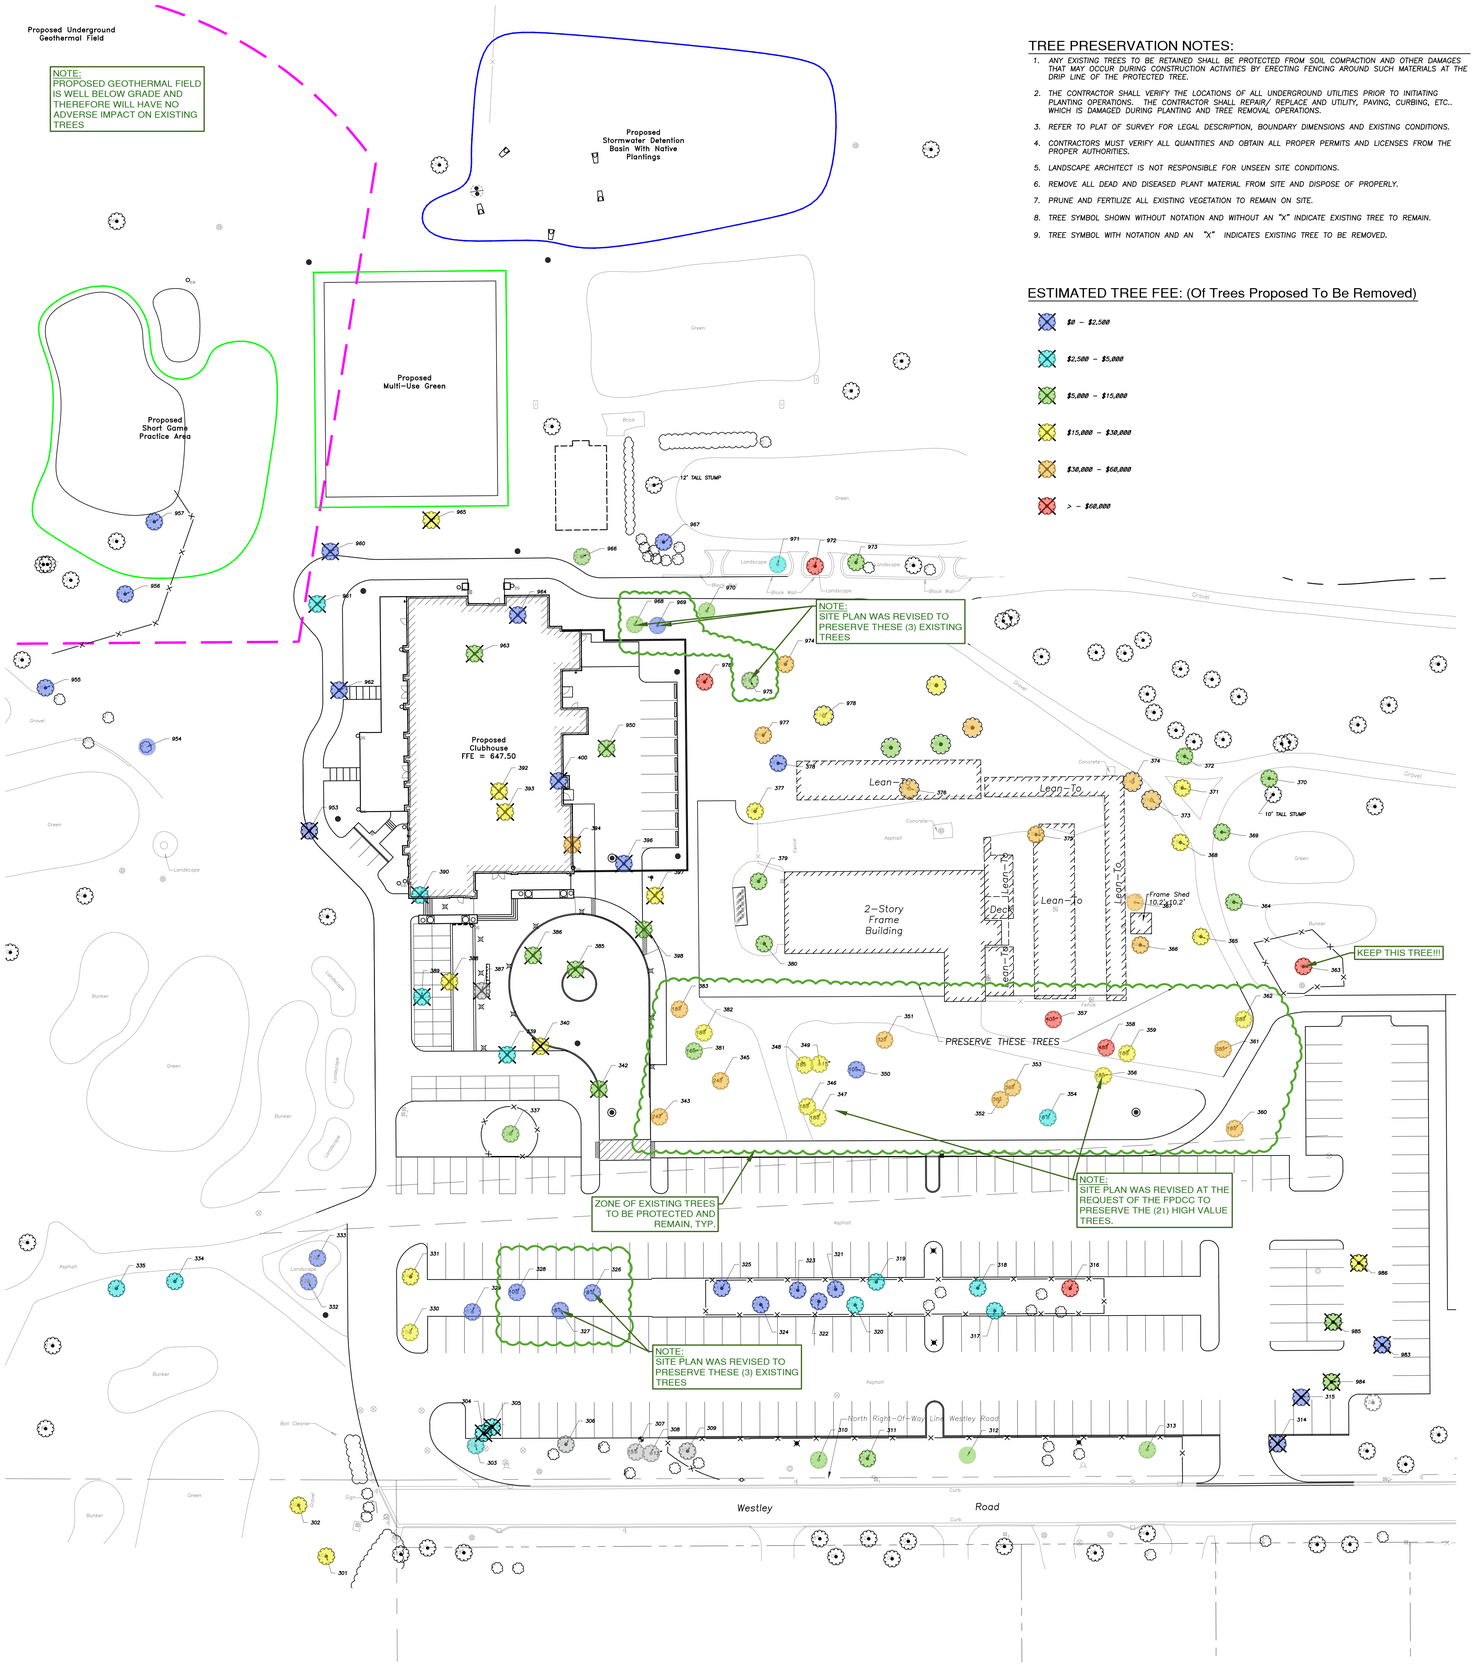

TREE PRESERVATION NOTES:

1. *ANY EXISTING TREES TO BE RETAINED SHALL BE PROTECTED FROM SOIL COMPACTION AND OTHER DAMAGES THAT MAY OCCUR DURING CONSTRUCTION ACTIVITIES BY ERECTING FENCING AROUND SUCH MATERIALS AT THE DRIP LINE OF THE PROTECTED TREE.*
2. *THE CONTRACTOR SHALL VERIFY THE LOCATIONS OF ALL UNDERGROUND UTILITIES PRIOR TO INITIATING PLANTING OPERATIONS. THE CONTRACTOR SHALL REPAIR/ REPLACE AND UTILITY, PAVING, CURBING, ETC.. WHICH IS DAMAGED DURING PLANTING AND TREE REMOVAL OPERATIONS.*
3. *REFER TO PLAT OF SURVEY FOR LEGAL DESCRIPTION, BOUNDARY DIMENSIONS AND EXISTING CONDITIONS.*
4. *CONTRACTORS MUST VERIFY ALL QUANTITIES AND OBTAIN ALL PROPER PERMITS AND LICENSES FROM THE PROPER AUTHORITIES.*
5. *LANDSCAPE ARCHITECT IS NOT RESPONSIBLE FOR UNSEEN SITE CONDITIONS.*
6. *REMOVE ALL DEAD AND DISEASED PLANT MATERIAL FROM SITE AND DISPOSE OF PROPERLY.*
7. *PRUNE AND FERTILIZE ALL EXISTING VEGETATION TO REMAIN ON SITE.*
8. *TREE SYMBOL SHOWN WITHOUT NOTATION AND WITHOUT AN "X" INDICATE EXISTING TREE TO REMAIN.*
9. *TREE SYMBOL WITH NOTATION AND AN "X" INDICATES EXISTING TREE TO BE REMOVED.*

ESTIMATED TREE FEE: (Of Trees Proposed To Be Removed)

- *$0 – $2,500*
- *$2,500 – $5,000*
- *$5,000 – $15,000*
- *$15,000 – $30,000*
- *$30,000 – $60,000*
- *> – $60,000*

N

30' 0' 30' 60' 90'

Scale: 1"= 30'

EXISTING TREE INVENTORY:

Tag No.	Botanical Name	Common Name	Size	Cond.	Form	Problems	Insect/Disease	Comments	Co-Leaders at DBH
301	Acer saccharinum	Silver Maple	25	3	3	multiple leaders, suckering			
302	Platanus occidentalis	Sycamore	27	3	3	basal decay, witches broom		Old tag # 585	
303	Salix nigra	Black Willow	17	5	4	side wires, damaged leader, dieback, multiple leaders, suckering, minor deadwood, broken limbs			Forked at 3' with 10", 8", 6.5" co-leaders.
304	Salix nigra	Black Willow	15	5	4	damaged leader dieback, suckering, double leader, basal decay			Forked at 4' with 14", 7" co-leaders.
305	Salix nigra	Black Willow	22	5	4	dieback, damaged bark, weak crotch, multiple leaders			
306	Rhamnus cathartica	Common (European) Buckthorn	7	3	3	suckering, minor deadwood			Forked at 3' with 7", 2", 2" co-leaders.
307	Rhamnus cathartica	Common (European) Buckthorn	6	3	3	slight lean, suckering, minor deadwood			Forked at base with 6", 2", 2", 2", 1", 1" co-leaders.
308	Rhamnus cathartica	Common (European) Buckthorn	6	3	3	minor deadwood, suckering, side wires			Forked at base with 4", 4", 4" co-leaders.
309	Rhamnus cathartica	Common (European) Buckthorn	5	3	4	slight sweep, twist in trunk, suckering, trunk scar, side wires			Forked at base with 5", 3", 4", 2" co-leaders.
310	Gleditsia triacanthos	Common Honeylocust	21	3	3	minor deadwood, suckering, side wires double leader			
311	Gleditsia triacanthos	Common Honeylocust	17	3	3	suckering, multiple leaders, side wires, minor deadwood, pruned for side wires, one sided			
312	Gleditsia triacanthos	Common Honeylocust	17	3	4	one sided, side wires, pruned for side wires, multiple leaders, weak crotch, suckering			
313	Acer platanoides	Norway Maple	15	4	3	dieback, weak crotch, multiple leaders, minor deadwood, girdling root, trunk scar, decay, side wires, pruned for side wires			
314	Pinus nigra	Black Pine	11	4	4	thick eye, side wires	Dendroctonus, pine shoot moth		Forked at 3' with 4", 3", 3" co-leaders.
315	Pinus strobus	Eastern White Pine	12	4	3	minor deadwood, lower branches shaded out, sparse foliage	chlorotic	Old tag # 1398	
316	Quercus rubra	Northern Red Oak	34	3	3	minor deadwood, epicormics, weak crotch, multiple leaders		Old tag # 1345	
317	Acer x freemanii	Freeman Maple	9.75	3	3	weak crotch, multiple leaders			
318	Acer x freemanii	Freeman Maple	10	3	3	weak crotch, multiple leaders, basal scar, surface roots			
319	Acer x freemanii	Freeman Maple	12	4	3	weak crotch, multiple leaders, basal decay, girdling root			
320	Acer x freemanii	Freeman Maple	14	4	3	weak crotch, multiple leaders, basal decay, basal scar, girdling root			
321	Syringa reticulata	Japanese Tree Lilac	16 Ith	3	3	overtopped, basal scar, suckering, weak crotch			
322	Syringa reticulata	Japanese Tree Lilac	16 Ith	3	3	suckering, weak crotch, trunk scar			
323	Syringa reticulata	Japanese Tree Lilac	14 Ith	3	3	suckering		3 co-leaders removed at base	
324	Pyrus calleryana	Callery Pear	6	3	3	suckering, multiple leaders			
325	Pyrus calleryana	Callery Pear	5.5	3	3	multiple leaders, suckering			
326	Malus spp.	Crabapple	4	3	3	suckering, branch scars, previously stubbed back			Forked at 3' with 3", 3", 2" co-leaders.
327	Malus spp.	Crabapple	8.5	3	3	multiple leaders, suckering, branch scars		Old tag # 1358	
328	Malus spp.	Crabapple	6.5	3	3	multiple leaders, minor deadwood, branch scars			Forked at 3.5' with a 6.5" co-leader.
329	Malus spp.	Crabapple	6.5	4	3	multiple leaders, branch scars, suckering, minor deadwood, woodpecker damage		Old tag # 1360	
330	Gleditsia triacanthos	Common Honeylocust	21	4	4	one sided, multiple leaders, dieback, fungal fruiting bodies at base, moderate deadwood, basal decay, side wires, pruned for side wires			
331	Gleditsia triacanthos	Common Honeylocust	22	3	4	side wires, pruned for side wires, suckering, multiple leaders		Old tag # 1361	
332	Malus spp.	Crabapple	15 Ith	3	3	suckering surface roots, multiple leaders			
333	Malus spp.	Crabapple	15 Ith	3	3	weak crotch, multiple leaders, suckering, surface roots			
334	Acer rubrum	Red Maple	6-25	5	5	trunk scar, one sided, double leader, trunk scar, basal decay, woodpecker damage	canker , borers	Old tag # 595	
335	Acer rubrum	Red Maple	9	5	4	weak crotch, suckering	canker	significant trunk damage/weak spot from canker	
337	Quercus bicolor	Swamp White Oak	14	2	2	minor deadwood, multiple leaders			
339	Celtis occidentalis	Common Hackberry	11	3	3	thin crown, minor deadwood			
340	Quercus alba	White Oak	20	3	3	multiple leaders, minor deadwood, epicormics		Old tag # 1197	
342	Quercus rubra	Northern Red Oak	9-25	3	4	slightly overtopped, slight sweep			
343	Quercus alba	White Oak	25	3	3	multiple leaders, Squirrel hole in lowest limb, multiple leaders, dieback, minor deadwood			
345	Juglans nigra	Black Walnut	26	3	4	one sided, minor deadwood	canker, borers	Old tag # 1188	
346	Quercus rubra	Northern Red Oak	18	4	4	hollow, epicormics, multiple leaders		Old tag # 1328	
347	Quercus alba	White Oak	17	3	4	overtopped, one sided, multiple leaders, slight sweep, epicormics			
348	Quercus alba	White Oak	18	3	3	multiple leaders, twist in trunk, minor deadwood		Old tag # 1326	
349	Quercus rubra	Northern Red Oak	18	3	4	slight lean, one sided, multiple leaders, minor deadwood		Old tag # 1327	
350	Malus domestica	Apple	8	5	4	decay, dieback, heavy deadwood, overtopped, slight sweep		Old tag # 1330	
351	Acer saccharinum	Silver Maple	34	4	3	hollow, multiple leaders, minor deadwood		Old tag # 1331	
352	Quercus alba	White Oak	24	4	3	damaged leader, one sided, minor deadwood, epicormics, trunk scar		Old tag # 1334, phone line suspended from secondary cable attached to trunk	
353	Quercus alba	White Oak	24	3	4	overtopped, one sided, minor deadwood, epicormics, double leader		Old tag # 1335	
354	Quercus rubra	Northern Red Oak	7	3	4	overtopped, slight sweep, minor deadwood			Forked at 2' with a 3" co-leader.
356	Quercus alba	White Oak	16	3	4	overtopped, slight sweep, thin crown, epicormics, moderate deadwood			
357	Quercus rubra	Northern Red Oak	34	3	3	twist in trunk, heavy deadwood, epicormics, surface roots, minor decay in surface root		Old tag # 1323, utility wires cabled to trunk	
358	Quercus rubra	Northern Red Oak	33	4	3	moderate deadwood, multiple leaders, dieback, broken limbs		Old tag # 1322, utility wires cabled to trunk	
359	Quercus alba	White Oak	19	3	4	overtopped, slight sweep, epicormics, minor deadwood		Old tag # 1321, utility wires attached trunk	
360	Juglans nigra	Black Walnut	22	3	4	slight lean, one sided, multiple leaders, broken limbs, suckering		Old tag # 1342, surveillance camera attached to trunk	
361	Quercus rubra	Northern Red Oak	27	3	4	excessive lean, multiple leaders, heavy deadwood, epicormics, old borer damage		Old tag # 1333, utility/low voltage wires attached to trunk	
362	Tilia americana	Basswood (American Linden)	21	4	4	hollow, over-topped, multiple leaders, suckering, hollow	borers	Old tag # 1318, utility/low voltage wires attached to trunk	
363	Quercus bicolor	Swamp White Oak	40	3	3	thin crown, epicormics, minor deadwood		Old tag # 1320, utility/low voltage wires and surveillance cameras attached to trunk	
364	Quercus macrocarpa	Bur Oak	13	2	3	multiple leaders, slight lean, weak crotch			
365	Quercus alba	White Oak	22	3	3	double leader, epicormics		Old tag # 1312	
366	Quercus alba	White Oak	27	3	3	damaged leader, multiple leaders, weak crotch, moderate deadwood		Old tag # 1311	
367	Quercus rubra	Northern Red Oak	27	4	4	damaged leader, broken limbs, top broken off, minor deadwood		Old tag # 1310, broken and hanging branches in crown	
368	Quercus alba	White Oak	15	3	3	twist in trunk, over-topped, slight sweep		Old tag # 1309	
369	Acer rubrum	Red Maple	13	4	3	hollow, metal in trunk, trunk scar		Old tag # 1305, net attached to trunk	
370	Quercus alba	White Oak	22	5	3	sparse foliage, decay, heavy deadwood, fungal fruiting bodies present, decay in buttress roots			
371	Quercus alba	White Oak	19	3	4	slight lean, epicormics, minor deadwood, decay in surface root			
372	Quercus alba	White Oak	15	3	4	twist in trunk, multiple leaders, minor deadwood, basal swell, lawnmower damage		Old tag # 1275	
373	Quercus rubra	Northern Red Oak	27	4	4	damaged leader, heavy deadwood, root decay, fungal fruiting bodies present		Old tag # 1308	
374	Quercus rubra	Northern Red Oak	24	4	4	broken limbs, heavy deadwood, damaged leader, multiple leaders, surface roots, lawnmower damage, decay in surface roots		Old tag # 1307	
375	Quercus rubra	Northern Red Oak	23	4	3	dieback, moderate deadwood, multiple leaders		Old tag # 1246 in cart storage area	
376	Quercus rubra	Northern Red Oak	36	4	3	damaged leader, heavy deadwood, epicormics		Old tag # 1247 in shed roof cutout, scorch marks on trunk	
377	Quercus alba	White Oak	20	3	4	slight sweep, damaged leader, one sided, heavy deadwood		utility wires attached to trunk	
378	Fraxinus pennsylvanica	Green Ash	8	4	3	trunk scar, suckering, minor deadwood			
379	Quercus alba	White Oak	10	2	3	basal swell, multiple leaders		limbs in contact with building	
380	Quercus macrocarpa	Bur Oak	13	3	3	weak crotch, multiple leaders, minor deadwood, epicormics			
381	Quercus alba	White Oak	14	3	4	over-topped, slight sweep, epicormics, minor deadwood		Old tag # 1191	
382	Quercus alba	White Oak	21	3	3	basal swell, epicormics		Old tag # 1190	
383	Quercus rubra	Northern Red Oak	23	4	4	minor basal decay, damaged leader, multiple leaders, upper cavity, dieback			
385	Carya ovata	Shagbark Hickory	10	3	3	double leader, slight basal swell			
386	Quercus bicolor	Swamp White Oak	10	2	3	weak crotch, double leader			
387	Quercus spp.	Oak	5-20	6	6	dead	canker, borers	dead	
388	Acer saccharinum	Silver Maple	25	3	3	surface roots, lawnmower damage, minor deadwood			
389	Celtis occidentalis	Common Hackberry	8.75	3	4	over-topped, surface roots, lawnmower damage, slight sweep, girdling root, minor deadwood			
390	Celtis occidentalis	Common Hackberry	11	3	3	multiple leaders, witches broom			
392	Quercus alba	White Oak	18	3	4	one sided, thin crown, epicormics, minor deadwood	two-lined chestnut borer	Old tag # 1224	
393	Quercus alba	White Oak	19	3	3	one sided, minor deadwood, epicormics		Old tag # 1225	
394	Quercus rubra	Northern Red Oak	30	3	4	damaged leader, broken limbs, dieback, multiple leaders, heavy deadwood, slight sweep		Old tag # 1229	
396	Celtis occidentalis	Common Hackberry	7	3	3	dying, root damage, multiple leaders			
397	Acer saccharum	Sugar Maple	19	3	3	girdling root, lawnmower damage, twist in trunk, multiple leaders			
398	Acer saccharum	Sugar Maple	15	3	3	girdling root, lawnmower damage, multiple leaders, one sided			
400	Carya ovata	Shagbark Hickory	8.75	2	3	twist in trunk			
950	Quercus macrocarpa	Bur Oak	11	2	3	weak crotch, multiple leaders			
953	Pinus nigra	Black Pine	12	3	3	lawnmower damage, multiple leaders		Old tag # 1496	
954	Magnolia x soulangeana	Saucer Magnolia	8 FH	2	3	weak crotch			
955	Magnolia x soulangeana	Saucer Magnolia	8 FH	2	3	weak crotch			
956	Malus spp.	Crabapple	9	4	3	weak crotch, decay, minor deadwood, suckering, crossing branches , sapsucker damage			Forked at 2' and 3' with 8.5", 6.5", 8.5" co-leaders.
957	Malus spp.	Crabapple	10	3	4	sweep, suckering, sapsucker damage, minor deadwood			Forked at base and 2' with 7", 6.5", 8" co-leaders.
960	Picea pungens	Colorado Blue Spruce	11	3	3	minor deadwood		limbed up	
961	Picea pungens	Colorado Blue Spruce	16	3	3	minor deadwood		limbed up	
962	Magnolia x soulangeana	Saucer Magnolia	12 Ith	3	3	suckering, trunk scars			
963	Fagus sylvatica	European Beech	26	3	3	surface roots, weak crotch, multiple leaders, girdling root, metal in trunk		Guy Gekerdt memorial tree	
964	Picea abies	Norway Spruce	12	2	3	infected			
965	Fagus sylvatica	European Beech	23	3	3	weak crotch, multiple leaders, minor deadwood			Forked at 3' and 4' with 7.75", 11.5" co-leaders.
966	Fagus sylvatica	European Beech	22	4	3	basal decay, multiple leaders, girdling root, branch scars, basal scar			
967	Malus spp.	Crabapple	8	3	3	trunk scar, suckering, minor deadwood			Forked at 2' with 6", 7" co-leaders.
968	Ostrya virginiana	Ironwood (American Hophornbeam)	9	3	4	over-topped, slight sweep, one sided, multiple leaders			
969	Morus alba	White Mulberry (Common Mulberry)	12	3	3	weak crotch, multiple leaders, minor deadwood			Forked at 3' with a 10" co-leader.
970	Quercus alba	White Oak	12	3	4	minor deadwood, basal swell, trunk scar, slight sweep	two-lined chestnut borer	utility wires attached to trunk	
971	Celtis occidentalis	Common Hackberry	14	3	4	over-topped, surface roots, slight sweep, multiple leaders			
972	Quercus alba	White Oak	42	3	3	trunk scar, upper cavity, epicormics, one sided	borers		
973	Quercus muehlenbergii	Chinquapin Oak	10	3	3	trunk seam/old trunk scar, multiple leaders, branch scars	borers		
974	Quercus alba	White Oak	22	3	3	weak crotch, minor deadwood, epicormics		Old tag # 1250	
975	Quercus rubra	Northern Red Oak	8	3	4	thin crown, twist in trunk			
976	Quercus rubra	Northern Red Oak	33	4	4	damaged leader, heavy deadwood, epicormics,		Old tag # 1235 utility wires attached to trunk	
977	Quercus rubra	Northern Red Oak	30	4	3	damaged leader, epicormics		Old tag # 1238	
978	Quercus alba	White Oak	20	5	4	heavy deadwood, dieback, damaged leader, epicormics		Old tag # 1246	
983	Celtis occidentalis	Common Hackberry	7	3	3	multiple leaders			
984	Pinus strobus	Eastern White Pine	14	3	3	Crowded thin lower branching		Old tag # 1413	
985	Carya ovata	Shagbark Hickory	11	3	3	slight lean to trunk			
986	Quercus muehlenbergii	Chinquapin Oak	18	3	3	Some twist in trunk		Old Tag # 1415	

fgma

FGM Architects Inc.
219 Milwaukee St, Suite 325
Milwaukee, Wisconsin 53202

414.346.7282 OFFICE

WISCONSIN STATE CERTIFICATE OF AUTHORIZATION WI #3101-11

CIVIL & LANDSCAPE ARCHITECTURE
ERIKSSON ENGINEERING ASSOCIATES, LTD.
145 Commerce Drive, Suite A
Grayslake, IL 60030
847.223.4804 (O)

STRUCTURAL
CLARK DIETZ
118 S. Clinton, Suite 700
Chicago, IL 60661
312.466.8242 (O)

M.E.P.F.P
CLARK DIETZ
118 S. Clinton, Suite 700
Chicago, IL 60661
312.466.8242 (O)

FOOD SERVICE
PROFITABLE FOODS
3115 South 4300 Road
Big Cabin, OK 74332
858.382.7323 (O)

PRO SHOP MILLWORK ORGANIZATION NAME
ADDRESS
CITY, STATE, ZIP
XXX.XXX.XXX.X (O) XXX.XXX.XXXX(F)
XXX STATE CERTIFICATE OF AUTHORITY
NO. XXXXXXXXXXX

NOT FOR CONSTRUCTION

FOR REVIEW ONLY

Not for regulatory approval, permit or construction.

The information on this document is preliminary or incomplete, not for construction, recording purposes, or implementation.

ISSUANCE

NO	DATE	DESCRIPTION
1	08/20/2024	Design Review

GLENCOE GOLF CLUBHOUSE
VILLAGE OF GLENCOE
621 WESTLEY ROAD
GLENCOE, IL 60022

DESIGN DEVELOPMENT

TREE PRESERVATION PLAN COLOR EXHIBIT

SHEET NO.
TP1.0

JOB NO. 23-3788.02

© 2023 FGM Architects Inc.

Copyright 2023 FGM ARCHITECTS INC.
EEA – P:\23235 – FGM – Glencoe Golf Clubhouse\Drawings\Glencoe Golf Club Clubhouse – Landscape Plan.dwg
Plotted: 9/27/24 @ 3:31pm By: sgregory